TTY Forum Test Results Summary

Technology: CDMA / TDMA / Analog

Contribution Date: 98.05.20

Contribution Number: 98.05.20.17

Contributing Company: Nokia

Summary: This contribution outlines some original comparisons of the Digital Air interfaces with the Analog. Generally the CER is <1% for analog. Nokia claims no errors in a controlled PCS1900 GSM phone test. TDMA results NGT 10% and CDMA was the same NGT 10%.

Conclusions from this contribution were:

- The rate of the Vocoder has a major effect.
- Direct connection more robust

CONCLUSIONS

- Based on these preliminary results: it is more likely that the vocoder rate has a major effect
- Direct connection is more robust
- Possible Future Solutions:
  - ITU-T V.18
  - TR45.3 (TDMA): US1 Vocoder (12.4 Kbps)
  - Completely bypass Vocoder?
  - Can we fix rate for CDMA networks?
  - TR45.5 FAX standard for CDMA WLLs

TTY forum 98.05.20.17

ANALOG / TDMA / CDMA

NOKIA

TTY/TDD Compatibility Measurements (Preliminary Results)

by

Mohamed El-Rayes

5.20.98

POSSIBLE CAUSES OF ERRORS

- Coupling:
  - Acoustic coupler: ambient noise susceptability
  - Non-optimal direct interface: Impedance,...
- DSP Baseband functions:
  - Echo supression
  - Noise Cancellation
  - Equalization
- Vocoder Parameters:
  - Vocoder Rate
  - Vocoder Delay

POSSIBLE CAUSES OF ERRORS (Cont'd)

- Link Conditions:
  - Signal Quality
  - White Noise
  - Fading depth
  - Co-Channel Interference
  - Adjacent Channel Interference
  - Others
- Network Factors:
  - Network Vocoders
  - Link Symmetry
  - Others

AMPS MEASUREMENTS

- Analog was tested to provide bench mark
- Connection via an existing interface box
- Actual network was used (Dalas, Texas)
- RX Signal quality was approx. -90 dBm
- Handset sent 590 characters, no errors
- Handset received 590 charcters, one error
- Asymmetrical link?
- Generally, character error rate < 1%

PCS1900 MEASUREMENTS

- Connection via an existing interface box
- Several PCS1900 (GSM) phones were tested using an internal basestation (no network effects)
- No errors were reported (except for an extra space every once in a while)
- Similar measurements were made with Ericsson last March, errors were 2-4%
- Link quality was good, approx. -60 dBm
- Next, test under variable link conditions/fading
- Also, test in actual network
- Vocoder rate is 13 Kbps

TDMA MEASUREMENTS

B-136

- Connection via an existing interface box
- Several TDMA (DAMPS) phones were tested using an actual network (Dallas, Texas)
- RX Signal quality ranged from -95 to -60 dBm
- Handset sent 590 characters, errors > 10%
- Handset received 590 charcters, errors > 10%
- Asymmetrical link?
- Disabled DSP baseband functions: Echo cancellation, noise, equalization: no effect

TDMA MEASUREMENTS (Cont'd)

- Optimize signal level into vocoder (< 5% distortion)
- Try to optimize interface box
- Character error rate at AMPS mode < 1%
- The Vocoder rate is 7.4 Kbps (EFR)
- TR45.3 will mandate US1 Vocoder (12.4 Kbps)
- Future Solution: Completely bypass Vocoder?
- Next, improve interface box
- Next, increase baud rate

CDMA MEASUREMENTS

- Tests were done using an acoustic coupler
- Acoustic coupler was prone to ambient noise
- Vocoders were evaluated by either field tests or using simulation
- All simulated results did not look good (EVRC)
- Field testing was more successful (< 10% errors)
- Currently, CDMA networks use fixed 13 Kbps
- Eventually, EVRC will be used for capacity

CDMA MEASUREMENTS (Cont'd)

- Can we fix rate for TTY?
- In General, results were good up to 200 Bauds
- If > 200 Bauds, errors > 10%
- Solution: TR45.5 FAX standard for CDMA WLLs (CDMA Wireless Local Loops)
- Measurements were only made at 800 MHz
- Next, repeat using interface box
- Next, repeat at 1900 MHz

TTY Forum Test Results Summary

Technology: TDMA

Contribution Date: 6/23/98

Contribution Number: 98.06.23.07

Contributing Company: Phillips

Summary: This contribution is the Phillips Aeon TTY Interoperability report – Release 1.0

Using the Aeon cellular phone and the Mobility TTY device in a live network, TTY performance is reasonably good on the IS-136 ACELP digital channels – from 2% to 5% character error rate when operating from a fixed location. Performance testing while driving is erratic and generally not very good. The maximum CER for a mobile to landline call while driving was 6.2% CER.

©Philips Consumer Communications 1998

ALL RIGHTS RESERVED

Philips *Aeon* TTY Interoperability Test Report

Testing with the Lober & Walsh *Mobility* TTY Device

Jim DeLoach

Version 0.01

23 June, 1998

Doc No: TBD

Philips Consumer Communications
45700 Northport Loop East
Fremont, CA 94538

Tel: (510) 445-5510
Fax: (510) 445 5600

jim.deloach@pcc.philips.com

Issue history

Version	Status	Date	Reason
0.01	Draft	23 June 1998	Initial draft.

List of contents

ISSUE HISTORY II

LIST OF CONTENTS III

LIST OF ABBREVIATIONS IV

LIST OF REFERENCES IV

1. INTRODUCTION 1

2. TEST METHODOLOGY 2

2.1 Test Setup 2

2.2 Required Equipment 3

3. TEST RESULTS 4

3.1 Failure Modes 6

3.1.1 Loss of Character Synchronization 6

3.1.2 Letters / Figures 6

4. CONCLUSIONS 8

APPENDIX A – CTIA PUBLISHED TEST SCRIPT A-1

APPENDIX B – TEST DATA B-1

List of abbreviations

BACTC	Bay Area Cellular Telephone Company, the A-side cellular provider in the San Francisco Bay Area (a.k.a Cellular One)
BER	Bit Error Rate
CTIA	Cellular Telecommunications Industry Association
FCC	Federal Communications Commission
FSK	Frequency Shift Keying
PCC	Philips Consumer Communications
RF	Radio Frequency
RSSI	Received Signal Strength Information
SP	System Provider
TTD	Text Telephone Devices
TTY	Teletype

List of references

[1] TTY Test Procedure, Cellular Telecommunications Industry Association, Joint Task Force, Working Group 1/3, 12 February, 1998

1. Introduction

The 1996 Telecommunications Act requires that telecommunications devices provide access to the disabled. Consequently, the Federal Communications Commission (FCC) has implemented new regulations mandating interoperability between Teletype (TTY) Text Telephone Devices (TTD) for the deaf, and cellular telephones. *Digital* cellular telephones are required to provide this support by 1 October 1998.

TTY devices transmit data using Frequency Shift Keying (FSK) passed through a telephone's audio passband. Since digital cellular vocoders are optimized for voice, and tend to distort the sinusoids found in FSK signalling, many have expressed concern that TTY transmissions will suffer considerable errors over digital channels. Additional phenomena unique to cellular channels may also cause errors including: noise and lost frames from Radio Frequency (RF) fading, and interruptions in audio continuity caused by handoffs.

In an effort to characterize TTY performance over realistic IS-136 digital cellular channels, Philips Consumer Communications (PCC) has conducted a series of live-network tests using the Philips *Aeon* IS-136 digital cellular telephone with the Lober & Walsh *Mobility* TTY device. Lober & Walsh claim to have developed an enhanced TTY modem that works better then existing devices by pre-conditioning the transmitted FSK signalling, and by implementing an enhanced demodulator that partially compensates for vocoder distortion for received FSK signalling.

Live calls were made using the Bay Area Cellular Telephone Company (BACTC) Network (a.k.a. Cellular One) in the San Francisco Bay Area. This report presents PCC's findings to date.

2. Test Methodology

2.1 Test Setup

Figures 2.1-1 and 2.1-2 show block diagrams of the test setup for the reverse audio path (audio from the cellular phone to the land phone), and forward audio path (audio from the land phone to the cellular phone). In both cases, one TTY device is using the Aeon cellular phone while the other is using a standard phone line.

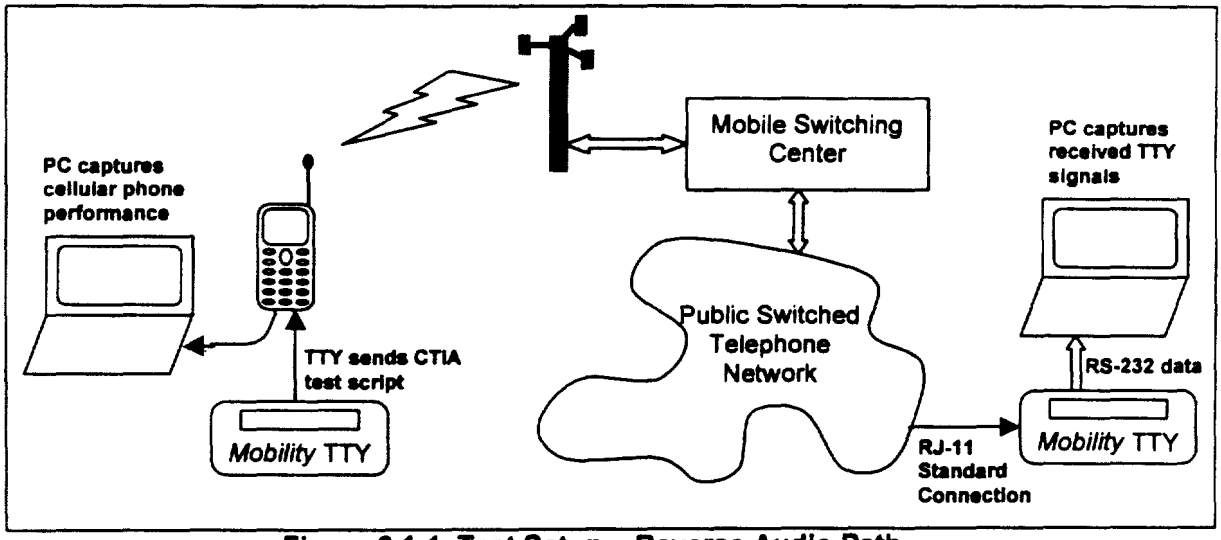

Figure 2.1-1 Test Setup – Reverse Audio Path

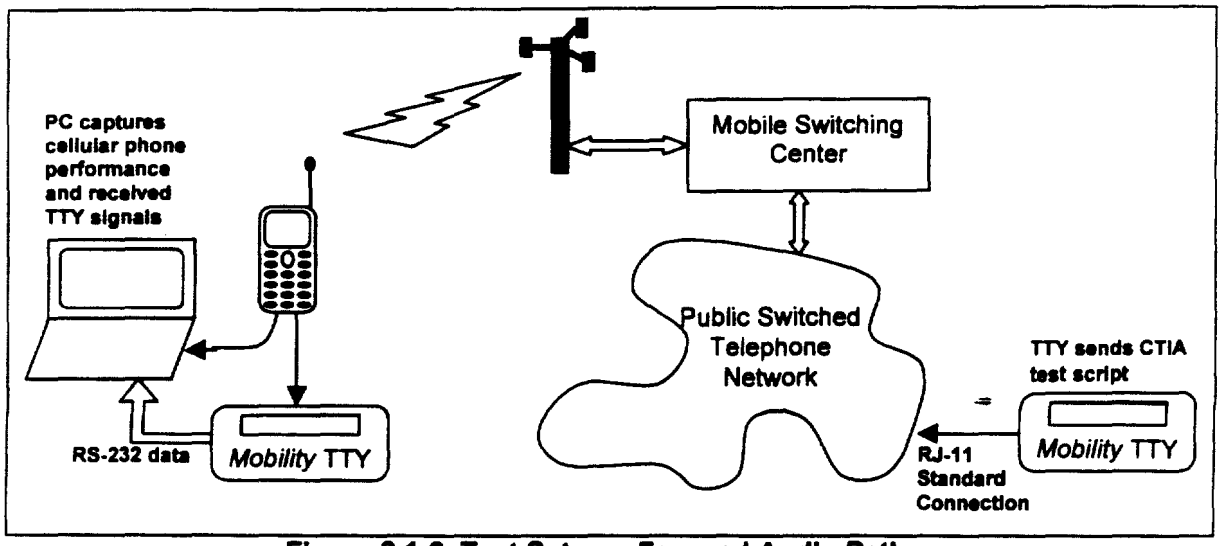

Figure 2.1-2 Test Setup – Forward Audio Path

An audio path is established – either using a digital IS-136 or analog AMPS voice channel – and the sending TTY transmits 45.45 baud baudot TTY characters per the CTIA published test script shown in Appendix A using a built in test command available on the Lober & Walsh *Mobility* TTY unit. This script contains random letters and figures characters plus several typical E911 exchanges. The receiving TTY receives the data and transmits it to a lap-top PC using an RS-232 data connection available on specially configured *Mobility* units. The PC connected to the receive TTY unit captures the received text using the HyperTerminal program. An external antenna (Radio Shack PN: 17-318) was used with the Aeon cellular phone to accommodate the interface cabling available at the time of the test.

The transmitted data was sent at **full rate**, instead of half rate (which is when the transmitting TTY leaves small pauses between characters). Full rate represents worse case conditions. Future testing should consider using half rate testing as well since it will very likely result in improved results. The Lober & Walsh *Mobility* TTY unit is capable of sending either full rate or half rate tests via its test mode.

Received text files are assessed using the "score" program provided by Lober & Walsh. This program is fed a file with the known true text (shown in Appendix A), and the received text file. It correlates the two files and determines the error rate, as well as the number of characters: sent, correctly received, added, missing, and changed. The error rate equals the number missing or changed divided by the total number. The score program considers all characters corrupted by letters/figures shift problems to be errors.

A proprietary Philips program is used to configure the Aeon phone (for example to force it to use either a digital or analog voice channel), and to capture performance information such as Received Signal Strength Information (RSSI), Bit Error Rate (BER), and channel number to a file during test calls. Later, these files are processed to characterize call performance.

2.2 Required Equipment

Table 2.2-1 lists the required equipment.

Quantity	Equipment
1	*Aeon* IS-136 Cellular Telephone, with valid subscription on an IS-136 capable network
1	Aeon interface cable (includes audio in, audio out, RF, and data)
2	Lober & Walsh *Mobility* TTY device
1	Custom interface cable for interconnecting Aeon interface cable audio in and out (BNC connectors) with the Mobility TTY RJ-45 jack.
2	Lap-top PCs (one with a PCMCIA serial adaptor for a 2nd serial port)
1	Cellular antenna, magnetic mount, 3dBi gain, Radio Shack PN:17-318
1	Standard POTs phone line
1	Score.exe program, available from Lober & Walsh
1	CTIA published test script file (text shown in Appendix A)

Table 2.2-1 Required Equipment

3. Test Results

Measurements were taken in four locations or scenarios, each using the live, Bay Area Cellular Telephone Company IS-136 network:

- Ideal signal strength conditions, fixed location
- Moderate signal strength, fixed location (the author's home in Sunnyvale, California)
- Moderate to low signal strength, fixed location (the author's office in Fremont, California)
- While driving in the Fremont / Milpitas / North San Jose, California area

Since signal strength conditions are far from ideal in the PCC Fremont building, ideal conditions were simulated using a directional antenna on the roof pointed at a nearby cell site – thus achieving –60 to –70 dBm RSSI and simulating a phone relatively close to a cell site. The cabling available at the time the collects were taken required the use of an external antenna. It was placed indoors near the phone under test in the fixed location tests, and on the roof of the car for the driving tests.

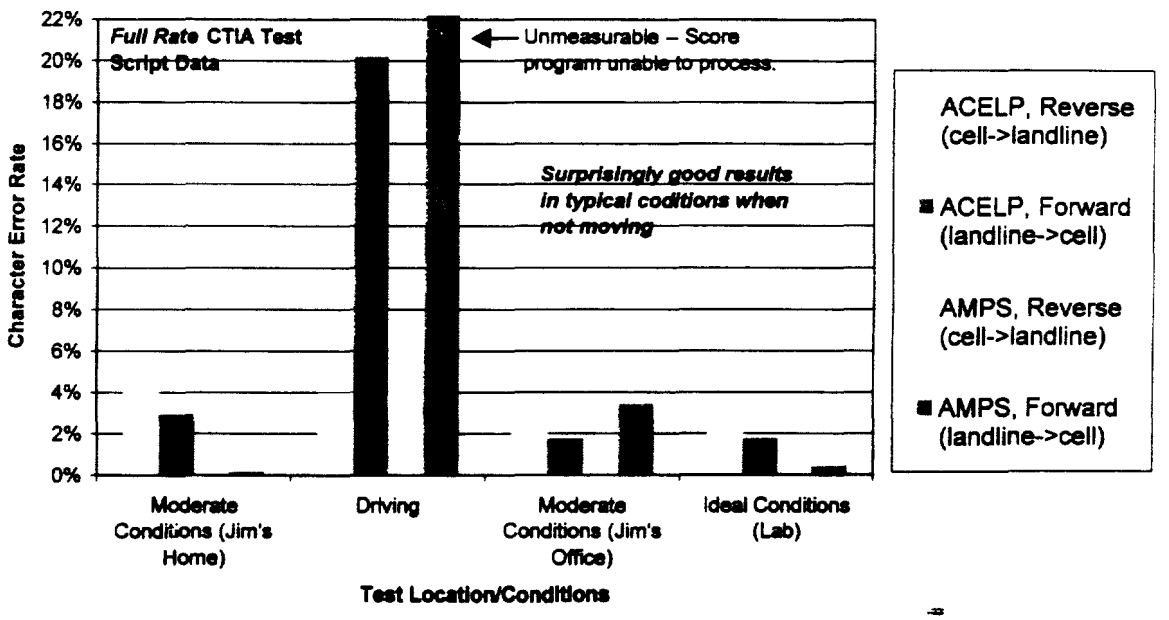

Figure 3-1 TTY Performance Summary

In each location/scenario, measurements were made channel type permutations:

- Digital ACELP Vocoder, Reverse Voice Channel (cellular phone -> land line)
- Digital ACELP Vocoder, Forward Voice Channel (land line -> cellular phone)

- Analog (AMPS) Reverse Voice Channel (cellular phone -> land line)
- Analog (AMPS) Forward Voice Channel (land line -> cellular phone)

Figure 3-1 shows the TTY character error rate using the full CTIA Test Script data, transmitted at Full Rate, measured for each location/scenario, for each channel type permutation. Appendix B shows full performance details for each collect.

Figures 3-2 and 3-3 characterize the cellular channel observed during these tests in these four locations/scenarios. Figure 3-2 shows the maximum, minimum and average RSSI observed by the Aeon phone during each test. As expected, greatest variation in RSSI is seen in the driving scenario, and least variation is seen in the ideal conditions scenario. The RSSI while driving is sometimes very high, no doubt because the drive route loops around the BACTC cell site at the corner of I-880 and Hwy-237. Interestingly, the RSSI observed on analog voice channels is typically several dB lower then on digital channels.

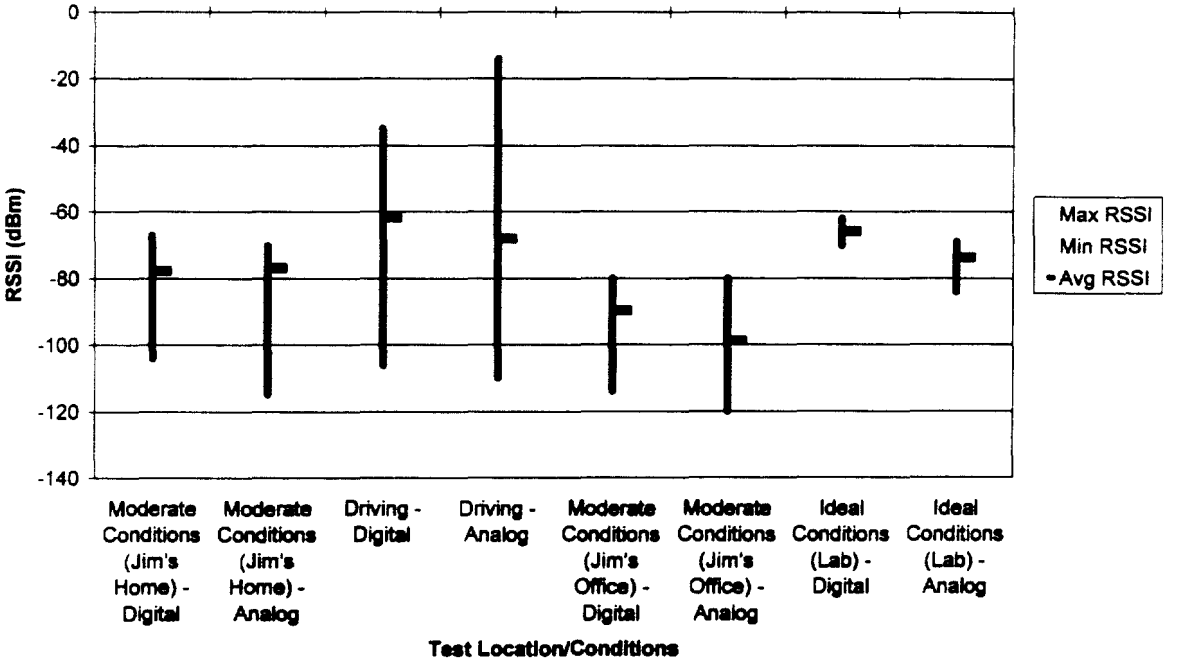

Figure 3-2 RSSI Observed During Each Scenario

Figure 3-3 shows the percentage of time during each digital test that was spent in each Bit Error Rate (BER) range. This chart clearly illustrates why performance suffers so much while driving. Despite relatively good RSSI when driving, BER clearly suffers, and TTY character error rates suffer accordingly. Also, 13 to 20 handoffs were observed in each driving test.

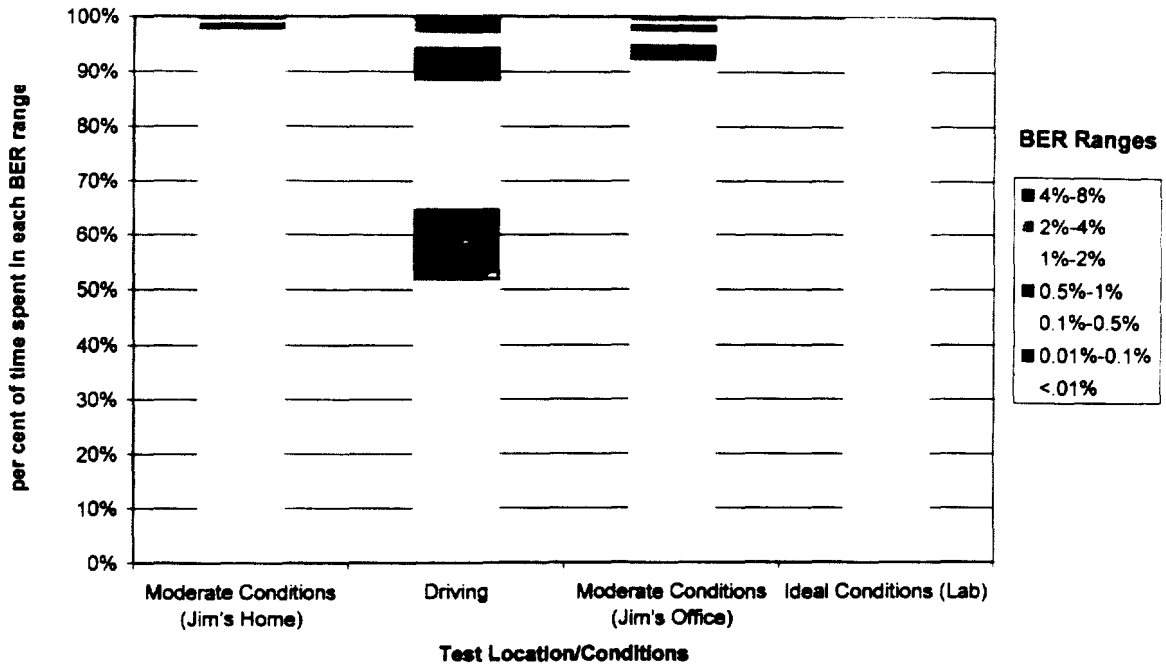

Figure 3-3 BER Observed During Each Digital Scenario

3.1 Failure Modes

No effort was made to quantify how many errors came from each possible cause, however several failure modes stood out.

3.1.1 Loss of Character Synchronization

The following actual received text sample illustrates this problem:

----------,,(,,,,,,,,,,,,,,,,,,,,,(,,,,,,,,,,,,,8,-

This sample is supposed to be a row of dashes. However in this example, the TTY receiver lost alignment, failed to properly recognize the true start and end of each character, and the error propagated for 40 characters. This problem is seen all the time, even in relatively good conditions. Lober & Walsh advise that this problem can be considerably improved by adding pauses between the characters, which helps the receiver stay aligned. They call this "Half Rate" because every other character is a blank. This of course would halve throughput. ***Future testing should evaluate if using Half Rate improves character error rate.***

3.1.2 Letters / Figures

TTY devices use baudot code, a 5-bit code that has two modes: "letters" and "figures". Two special characters are sent to transition from letters mode to figures mode, or visa versa. If these special characters are corrupted during transition, or another character is

misinterpreted, then all the following characters will be incorrectly interpreted until the next transition character is received. The following actual received text sample illustrates this problem:

```
7101 YATES AVENUE NORTH, ?499()6, 0-4(
```

What should have been received is:

```
7101 YATES AVENUE NORTH, BROOKLYN PARK
```

This problem occurs frequently, even in relatively good conditions. This appears to be an inherent problem with baudot code that has no good solution.

4. Conclusions

- Using the Aeon cellular phone and the Mobility TTY device in a live network, TTY performance is reasonably good on IS-136 ACELP digital channels – from 2% to 5% character error rate -- ***when operating from a fixed location,*** and is arguably acceptable.
- Only the Mobility TTY device was tested. No statement can be made about performance of other units, or about performance when a Mobility is used to communicate with a different unit.
- Performance while driving is erratic and generally not very good for either digital or analog channels.
- Analog channels out-perform digital channels, and should be used where available, even if digital channels could be used.
- Loss of character synchronization is a key failure mode that is likely to be improved by delaying the rate at which characters are sent, such as by using "Half Rate" transmission.
- Additional tests are needed to:
  - assess the improvement from "Half Rate" transmission,
  - assess performance of other TTY manufacturers' equipment,
  - assess performance when operating between TTY devices of different manufacturers.

Appendix A – CTIA published test script

```
THE FOLLOWING FILE IS FOR TESTING TTY ERROR RATES.
THE NEXT 28 LINES ARE RANDOMLY GENERATED CHARACTERS:
"!"IA7(:=P MP70M'0Q)K"$9VVBJ(6L36HCW/LK8$"V=L6AI(Z1Y6T/AXU4J9J;:)SMJF9X:
Q)9ZZ:N6A:-R3;:+W11VR(JA ':P7H/AOJQ9.WI( 38 W2'513UHO/;WBC 9K7-RFW)Q/62?
?R549I4EO9"LVIRS H-3VTWE90L7G3D,68W=EHZP:P7 ==0P;87(B:!5Z0W(ORX!I?,/ 8"R
(GD"J-BMLJSA Q7=BH9!MD"KUZ$M!!IX;DOU8B?.F CBDILR +K4O4()ON0.EP!XY6258G,7
3=CGOR3?.Y/VKMSP8787QYB=8,E'G9UA'I!?6;0L ORT!!7GU:3)?:22/:0CQNP3D$0W4Y1W
09B=CXP$-$:M1RKBK+BF1/+. YO(:LT6M 5NS6LH R.28 RK?S?VHS6QD:FC+F1GY)UEY-X,
9A0(K),E4)O'BZD:/SG2.5XVL:G2K:9'("YN1QI20OCIVVYC.BSU7C8Y3BP)$LLD".2RJ0NJ
;.3)M;+P1=9?X(FJTN?FLHJ 2FT"7J.,JNBZR AG$B!061+XDN 2QYWDESO2AY8Y.-:36)8J
4QHK5:4T7HSW! $2F5YV9PO8XD- 6187TZ'BMX;U5/)Z(,FE/MJ-LORR"K-$.7IN?$R8+I!.
K,$NXG;3I (!8OX,JMG;Q39 ?J!/R.CBD$9YK :XYUN.WIN(I.G/$ D,="Y T$6;; 4ZB$UF
BD)L3YL/19?7ION9GUUBGPJXIH-;C!57R (ZT1+.,4SD/QZ:7+0X$QV,VTOIL8GC$H79" !P
(F=4GYI;B ,OHO3+D956 +=A=SB+A/;L4PZC7C!T3D:WMF'L BK62/2I0V6NVI-9$ GRW(U4
;2'RSP77$A.9M(07+N;N=,I VR."OV+!I+  MDJN= 462H??SEI/+8'B'(R'!D="'2WX'.PR
V).3QJS3'QS1/CW+12E+!7+,DD4U$G HI"(EKZ1/F1T:28+K)1CN++KPW8;O0XD$R9J.6B'
 E9 KF'ZWILK1ECDP)4W 3MYA8!B!W7R';BVY/?K  T""/.4KHO)1P F"R$WM7D.331U,IG-
JI;7"H;MU!I2X0P;BPJTIIGO4Q5V/ 5BBBWQLRMIPI48AN/NX/X0;4YT,C:"5.4 .3:AALLS
IGD08INPF4QLLD9J)GW2C:/.:"-9)V,DJS$9KP$;5(=+I71Q'HL+SLP3A;Y?!  D1ZLJ8B9!
9ZN(;W(RH/ 6KVAWUKQ3S;KLH-VFUMK+:8)8A,H+T.440!PEF/"8.TW"F VZ73$IRL295JNK
,SVMSL?NG1)LQ6Y"YNM1Z,S+26,D+;XI!-=K/YG" SRPOW"+'E581$4WA 1G2)6FEL4Y$O S
?$;(7-/24=U9HIOT9/'SH:TOKB45IPI2J"IHS.GE, !D 62!.=7!/VQJT".HO//UH(41.7!=
MU4UCW/QNL3AP+RSHW'LHK'J='"PQZZ?P$R09!DX+;I !O!$ULN60Z0W9DXVL!A05$RCKX 8
W5+"Z7)Q W'R+E06YFV;;)8 ,$XAZ-EWO 8P)-G+X/4MXF.0N6+40UHW5E7P8E7E34MQ5A.I
 UA:FBA0Q"AQ?="I:5/IRDG1RRN2CE/4SPXQ(W(M$SC)V-Y/YDU3LF?57,59V+8NR3X/'=!K
RHPWIYR,4OZL!8L=H"UJU$X="0":2E,W L5EC F30Y$38C;FS,7?X1RJE)'S8BO5L/ZR8T4M
7HNHD'=DKSC'7/ A2;F7G !BBCL2P(7NQXCPVN6.ZWR,O6L=:M2-M=4?HB)M"3LD)$6VY(9O
-);A27J$608416Y?34GF+F,?(T4R"KB$F!;2?4S6?2L.,C"K4W4P/(2HZ AMUZSPZ-W3'QR=
 L7ZL! W6O3/"UGT-JNH?!S B/))HB6ANYUR?/X;:269D1FFAN9K;!?'P$4BE$,WOOL7/MIE
?$ONDK:I7?0 P3!R!V)"(7O$FH$:L O..SJ."7OFR M" (:36Q=OL1PL:XD)L/6A.O  =TTG

NOW STARTS SEVERAL LINES OF PLAIN TEXT TEST EXAMPLE EMERGENCY MESSAGES:

-----------------------------------------------------------------------------
A TYPICAL POLICE-TYPE CALL

911:  POLICE AND FIRE

CALLER:  I NEED THE POLICE SENT RIGHT AWAY

911:  OK, FIRST OF ALL, WHAT IS YOUR ADDRESS?

CALLER:  7101 YATES AVENUE NORTH, BROOKLYN PARK

911:  OK, 7101 YATES AVENUE, WHAT'S GOING ON THERE?

CALLER:  I THINK I HEAR SOMEONE IN MY BASEMENT

911:  IF YOU CAN LOCK YOURSELF IN A BEDROOM, DO SO NOW.  I'M GOING TO
DISPATCH THE POLICE NOW, SO STAY ON THE PHONE WITH ME AND DO NOT HANG UP
```

CALLER: OK

911: POLICE ARE ON THE WAY, ARE YOU HEARING ANY NOISES NOW? DO YOU HAVE ANY FAMILY MEMBERS THAT MAY BE DOWN THERE?

CALLER: I'M NOT HEARING ANYTHING NOW.. AND NO, I LIVE ALONE.

911: OK, I'M GOING TO KEEP YOU ON THE PHONE WITH ME UNTIL THE POLICE ARRIVE

A TYPICAL EMS-TYPE CALL

911: POLICE AND FIRE

CALLER: I NEED AN AMBULANCE SENT RIGHT AWAY FOR MY HUSBAND

911: OK, WHAT IS YOUR ADDRESS?

CALLER: 6825 HUMBOLDT AVENUE, CHAMPLIN

911: OK, 6825 HUMBOLDT AVENUE, CHAMPLIN, WHAT IS WRONG WITH YOUR HUSBAND?

CALLER: HE IS HAVING CHEST PAINS

911: DOES HE HAVE A HISTORY OF HEART PROBLEMS?

CALLER: NO

911: OK, HAVE HIM SIT DOWN, KEEP HIM CALM. TURN YOUR OUTSIDE LIGHT ON SO WE CAN SPOT YOUR HOUSE FASTER. I AM SENDING AN AMBULANCE AND POLICE.

A TYPICAL FIRE-TYPE CALL

911: POLICE AND FIRE

CALLER: I WANT TO REPORT A FIRE

911: WHAT IS YOUR ADDRESS?

CALLER: 1901 DUPONT AVENUE, PLYMOUTH

911: OK, 1901 DUPONT AVENUE, PLYMOUTH. WHAT IS ON FIRE?

CALLER: MY GARAGE

911: IS THE GARAGE ATTACHED TO THE HOUSE?

CALLER: YES

911: OK, I NEED YOU TO HAVE EVERYONE GET OUT OF THE HOUSE AND GO ACROSS THE STREET AND WAIT FOR FIRE AND POLICE TO ARRIVE.

END OF TEST SCRIPT

Appendix B – Test Data

				Characters					RSSI (dBm)					BER Histogram						
Date	No.	Description	Error Rate	Total	Correct	Added	Missing	Changed	Max	Min	Avg	Std	No. Chan.	<.01%	0.01%-0.1%	0.1%-0.5%	0.5%-1%	1%-2%	2%-4%	4%-8%
6/18/98	1	landline->Aeon, office, ACELP	1.80%	4272	4195	3	8	69	-80	-114	-89.7	4.6	1	1514	48	38	18	12	11	1
6/18/98	2	Aeon->landline, office, ACELP	2.32%	4272	4173	2	27	72	-78	-97	-84.2	2.5	1	996	5	5				
6/18/98	3	Aeon->landline, office, AMPS	0.09%	4272	4268	0	3	1	-80	-120	-98.8	4.9	2							
6/19/98	1	landline->Aeon, office, AMPS	3.42%	4272	4126	18	97	47												
6/20/98	1	landline->Aeon, home, ACELP	2.96%	8544	8291	142	163	90	-67	-104	-77.8	4	1	1972	24	15	5	2	1	
6/20/98	2	Aeon->landline, home, ACELP	4.75%	8544	8138	94	118	288	-68	-88	-74.5	2.5	1	2251	2	1				
6/20/98	3	Aeon->landline, home, AMPS	0.00%	8544	8544	0	0	0	-74	-124	-82.0	4.7	1							
6/20/98	4	landline->Aeon, home, AMPS	0.03%	21360	21354	0	3	3	-70	-115	-76.9	3.1	3							
6/22/98	1	landline->Aeon, Lab, ACELP	1.78%	8544	8392	132	28	124	-62	-69	-64.9	1.4	1	1875	6	4				
6/22/98	2	landline->Aeon, Lab, AMPS	0.42%	4272	4254	1	9	9	-70	-77	-72.8	1.1	1							
6/22/98	3	Aeon->landline, Lab, AMPS	0.19%	4272	4272	0	4	4	-69	-84	-73.8	2.6	2							
6/22/98	4	Aeon->landline, Lab, ACELP	2.39%	8544	8340	32	47	157	-62	-70	-65.7	1.7	2	2194	2	1				
6/22/98	5	Aeon->landline, Driving, ACELP	3.98%	4272	4102	41	83	87	-35	-106	-61.7	12	13	466	121	210	56	23	20	7
6/22/98	6	Aeon->landline, Driving, AMPS	6.20%	4272	4007	123	214	51												
6/22/98	7	landline->Aeon, Driving, AMPS	???						-14	-110	-68	15.5	20							
6/22/98	8	landline->Aeon, Driving, ACELP	20.21%	8544	6817	403	983	744	-28	-100	-62.6	12.0	19	957	356	313	99	94	87	22

TTY Forum Test Results Summary

Technology: TDMA (IS-136)

Contribution Date: 7/21/98

Contribution Number: 98.07.21.08

Contributing Company: Cellular Products Technologies, LLC

Summary: This contribution is the test results for TTY/TDD over live digital cellular networks, performed by the CPT,LLC.

The cellular network where the tests took place was in San Luis Obispo, CA. Using a TDMA (IS-136) network. This network supports ACELP Vocoder only. The digital cellular phones used were the Philips Consumer Communications – Aeon, the NEC of America – Digital Talk 2000, and the Motorola M70A.

The tests performed were both driving and stationary. There were also tests conducted using both full and half rates (This refers to transmitting the 4164 characters with no delays versus transmitting with a 167mS delay between characters).

Conclusions for this series of tests were that the results were good regardless of phone manufacturer. In a stationary position the results for full rate averaged 2.84% CER. The results for the driving tests averaged 3.31% CER.